


LAND CORNER RECORD


Index: U-9	Corner: S 1/16 between Sections 28 and 29	State of Indiana - Hoosier National Forest		
Section: 29	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1370428.90	Long./E: 3140010.63	Datum: NAD83 IN West Zone, US Survey Feet	

CORNER HISTORY: (Chronological history of corner)					
1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		Monument Photograph: 
10/8/1963	P.M. Williams USFS Survey Tech.	6"X8" Stone ith "X" on top fd. 4" above grade	USDA Forest Service Bedford, IN		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
Record evidence of prior survey:	In 1978 the US Forest Service noted that there was evidence of a traverse line to this stone and flagging at the stone. Also set a 3" Iron pipe with a 3" stamped brass cap in 1978.				
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:		
9/26/1990	Ken Anderson L.S. #80040545	3" Iron pipe with a 3" stamped brass cap set	USDA Forest Service Bedford, IN		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Black Cherry*	13"	N10°E	7.40'	
	Ironwood*	7"	N70°E	7.60'	
	* = not marked in 1990	Stone w/"X" on top	5"X7"	N11°W	16.94'
Record evidence of prior survey:	In 1978 the US Forest Service set a 3" Iron pipe with a 3" stamped brass cap. In 1990 a Land Corner Record was made. A cut limestone N11W 16.94ft from the set pipe was not accepted as the 1/16 corner.				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Black Cherry	18"	N12°E	7.41'
	Iron Wood	24"	N70°E	7.90'
	Cut Limestone w/"X" on top	4"X6"	N12°W	16.97'
	Sour Gum	20"	S18°W	25.89'
Monument Found or Set:	A 3" iron pipe with a 3" brass cap stamped "T7N R1E S.29 1/16 S.28 1990 S0545" found 0.7' above grade.			

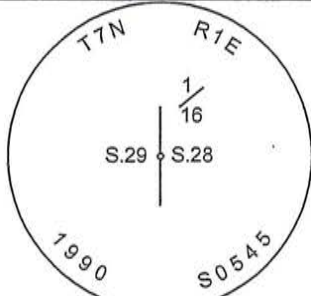MONUMENT SKETCH	NARRATIVE REFERENCE:
	Monument is a 3" iron pipe with a 3" brass cap stamped "T7N R1E S.29 1/16 S.28 1990 S0545" found 0.7' above grade, a carsonite post is located south 1.0' of the monument, located +/- 30' south of an east-west running path. +/- 100' west of an open field. On the tip of a ravine going to the south. +/- 300' southeast of Chapel Hill Road. In a north-south running treeline.

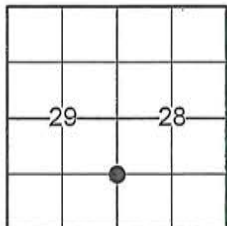SECTION DIAGRAM	PERPETUATION RECORD:
 Corner Location = ●	The record monument was found undisturbed and maintained by marking two existing bearing trees recovered from a Land Corner Record by Ken Anderson, dated 9/26/1990 and one new bearing tree. Bearing trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and mag nail, unless otherwise noted. <i>Referenced on BRCJ survey recorded as InstNo.2018004724</i> <i>Accepted by the Monroe County Surveyor Review Board on August 6, 2019.</i>
Section: 29 T7N R1E	Prepared By: BRCJ (Project#3-0820) Date: 2/2018

Index No U-9 LAND CORNER RECORD FSM 7150
 T. 7N R. 1E 2nd P. Mer. County Monroe State of Indiana
S 1/4 Corner common to Sections 28 & 29 Hoosier National Forest

EXISTING SURVEYS

Original Government Survey
 Year Surveyed 1814 By A. Henrie
 Original Monument None set
 Species Dia Bearing Dist
 BT's _____

Original Survey evidence Found
 Date of Search _____ By _____
 Monument Found _____
 Orig. Species Dia Bearing Dist
 BT's _____
 Found _____

Subsequent Corner Restoration
 Date Surveyed _____ By _____
 Where Filed or recorded: _____
 Book: _____ Page _____

Evidence of Subsequent Corner Restoration Found
 Date of Search _____ By _____
 Monument Found _____

Monument Set No evidence was found of a subsequent County Survey
 BT's Species Dia Bearing Dist
 Ref. A Forest Service Corner
 Obj. square stone was found about

Species Dia Bearing Dist
 BT's dated 10/8/63, by P. McWilliams, Notes a 5"x5"x5"
 Found behind Sath Chapel Hill road & south woods trail.

Subsequent Corner Restoration
 Date Surveyed 1978 By K. Anderson
 Where Filed or recorded: Forest
 Book: _____ Page Service files

Evidence of Subsequent Corner Restoration Found
 Date of Search 9/26/90 By Ken Anderson
 Monument Found Iron pipe with brass cap, unmarked, and stone with + on top. Stone is milled and does not look like an original corner stone.


Monument Set Found - Stone
 BT's Species Dia Bearing Dist
 Ref. Monument Set - Iron Pipe
 Obj. 2 3/4" x 4 feet long with 3" brass cap

Species Dia Bearing Dist
 BT's I did not consider the stone to
 Found be authentic or set by survey

OTHER EVIDENCE

Describe corner location relative to nearby features and how to reach the corner location - note fences roads, timber, streams, topo changes, etc: on flat area south of county road in N-S tree-pence line. area to east is old field reverting to brush/woodland and mostly pole sized hardwoods. woods roads are 30 feet North and 20 feet west of monument. A wood post with survey sign is 4 ft west of monument

Sketch of Monument

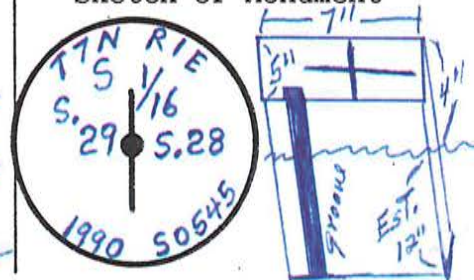

PERPETUATION RECORD

Monument: Describe new monument set, or work done to preserve existing monument.

Iron pipe was left as found. position was determined during 1978-9 survey of Section 29. Cap was stamped with corner ident. & location.

Accessories: Describe new Bt's and/or witness objects established or work done to preserve existing evidence

Black Cherry Ironwood BT's are unscrubbed
13" 7" not tagged or painted.
N10E N70E Stone N11W
7.4 feet 7.6 feet 5"x7"x4" 16.94 Feet

CORNER DIAGRAM

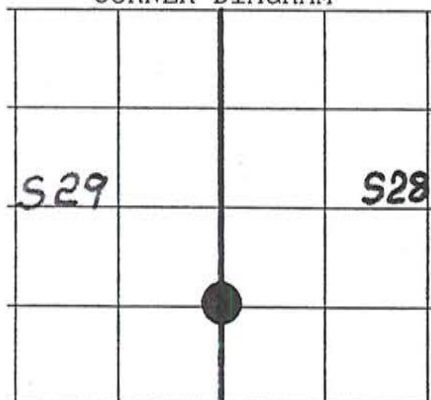


Photo Identified

Photo # 284-224

Strip/Series 30/1984

Pinpricked yes

Search Hours 2 Minutes

Corner Recordation

Certificate prepared: No

Filed or recorded in County

Records: Date: _____

Book: _____ Page: _____

Corner Record by: Kenneth W. Anderson Date: 9/26/90

U.S. GOVERNMENT PRINTING OFFICE: 1960-553244 **U9?** LAND CORNER RECORD 5680-2

1. T. 7N R. 15E No. _____ Cor. _____ Mer. 2nd State Iowa N. F. Harrison Dist. Harrison

2. Corner Status _____

3. Original Description _____ Vol. _____ Page _____ Where Recorded _____

4. Description of Corners:
5" x 5" x 5" square stone with cross

5. Investigation Notes: Stone is approximately 6 chains south of Chapel Hill road and 15' south of woods trail. In a sassafras fence row

7. Photo Identification
Photo No. _____
Ident. By: _____

8. Plane Coordinate Position Data
State _____ Zone _____
X _____
Y _____
Estab. By _____
Field Book No. _____
Where Filed _____

9. Evaluation
Authentic _____
Needs Verif. _____ Monument _____
Re-estab. _____ Survey _____
Land Status _____

6. Signed Patrick Williams Title Field Tech Date 10/2/63

Sec 29 5 1/6 E Line

4-14-78

6" x 8" limestone w/ X set in ground
4" above surface - survey lath there
to red ribbons on trees. Evidence
of surveying work, cut trees, ribbons,
etc. Stone about 10' feet south
of old woods road & on edge of clearing.

★ U. S. GOVERNMENT PRINTING OFFICE: 1960-553244

U9?


LAND CORNER RECORD

(Rectangular)

5680-2

1. T. 7N R. 1E No. _____ Cor. _____ Mer. 2nd State Iowa N. F. Harrison Dist. Johnson

2. Corner Status

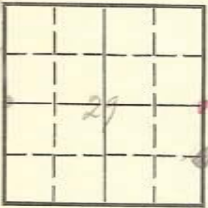

3. Original Description _____ Vol. _____ Page _____ Where Recorded _____

4. Description of Corners:

5'x5'x5' square stone with cross

5. Investigation Notes:

Stone is approximately 6 chains south of Chapel Hill road and 15 south of wood's trail. In a sassafras fence row

7. Photo Identification

Photo No. _____

Ident. By: _____

8. Plane Coordinate Position Data

State _____ Zone _____

X _____

Y _____

Estab. By _____

Field Book No. _____

Where Filed _____

9. Evaluation

Authentic _____

Needs Verif. _____ Monument _____

Re-estab. _____ Survey _____

Land Status _____

6. Signed Patricia Wams Title Forrestry Tech Date 10/12/63

PERPETUATION RECORD

10. Monument:

11. Accessories

12. Set By _____ Title _____

License _____ Agency _____ Date _____

13. Recorded By _____ (Agency) _____ Volume _____ Page _____

(Date) _____ (City) _____ (County) _____ (State) _____

14. Remarks: